

SITE SPECIFIC RECOMMENDATIONS

EAST REGION: East York District

LOCATION R. V.  
Burgess East

Ward

1

INVENTORY #	BUILT	DEFICIENCIES	RECOMMENDATIONS	COST			OTHER
DESCRIPTION				REPAIRS	LABOUR	BASE	CONSIDERATIONS
PLG01SSM		-S-hooks	-replace	10	1		
2 Belt		-chipped	-repaint	50	2		
		-encroachment	-remove border		4		

INVENTORY #	BUILT	DEFICIENCIES	RECOMMENDATIONS	COST			OTHER
DESCRIPTION				ESTIMATE REPAIRS	LABOUR	BASE	CONSIDERATIONS
PLG02SSM		-improper spacing	-remove two, adjust spacing		1		
6 Belt		-S-hooks	-replace	10	1		
		-encroachment	-remove border		4		
PLG03SSM		-tire	-remove tire, add two baby swings	200	2		
Tire Swing		-encroachment	-remove border		4		
PLG04SRM		-barriers	-add pickets	600	8		
Sr. Cr. Structure		-double slide sides	-add 4" side	600	4		
		-slide side	-add 4" sides	400	4		
		-steering wheel	-replace with solid	60	1		
		-fireman pole	-replace	100	2		
		-entanglement	-weld	50	2		
		-entrapment	-add access component	50	2		
Base Material		-non sufficient safety zone	-excavate		12	2000	
			-add base material 77 T		8	1220	
<b>Total Cost</b>				<b>2130</b>	<b>62</b>	<b>3220</b>	